

# Weller®

## **Fume Extraction Solutions**

We care for your working environment.





## Content

Why Fume Extraction?	3
Zero-Smog® System	3
<b>3</b>	
Tip Extraction and Volume Extraction	4
Filter Technology	5
Filter Process	5
Volume Extraction	6 – 17
WFE 8S	8
WFE 4S	9
WFE 2X	10
WFE 2S	11
WFE 2ES / WFE 2CS	12
Installation Options	13
Accessories	14 – 17
Spare Part Filter	17
Tip Extraction	18 – 26
WFE	20
WFE P	20
WFE 20D	21
FE (Fume Extraction) Soldering Irons	. 22 – 23
Safety Rests	. 23 – 24
Accessories	25
Spare Part Filter	25
Installation Options	26
Pipe Systems for Tip and Volume Extraction	27



#### Why Fume Extraction?

Many work environments today, including soldering, adhesives, welding and laser applications, create particles and gases that can be harmful to the work place and the environment. Most people thought that the move to leadfree soldering would be more nature friendly. In reality lead-free soldering smoke emissions contain more breathable fine dust particles. More and smaller particles are produced due to the higher working temperatures required and because more flux is used in the soldering process.

In many countries legal regulations governing clean air in the work place require that hazardous substances are removed from the air in order to avoid harmful effects on people and machines. It is important to use the correct safety equipment to remove these hazardous substances. Fine particles are more dangerous to inhale than big particles as they get caught more easily and block the alveoli in the lungs.

To protect the operator it is important to use an extraction system that is able to separate these particles and gases and then re-circulates the cleaned air back into the work place. This saves energy and reduces energy costs.

#### **Zero-Smog® System**

The Zero-Smog® Systems from Weller® protect operator and the environment. Their filter systems catch the polluted air right at the source, and prevent the diffusion of particles and gases.

The Zero-Smog® Systems have a broad range of filters that can be combined to provide the best solution to the problem. The standard filters are designed for the needs of lead-free soldering, adhesives and laser applications but Weller® has filters suitable for all the most common applications found in industry and laboratories.

The Zero-Smog® Systems help to create a **good** work environment. They are small and easy to place and have **low noise level** emissions. Extraction arms and nozzles are adjustable so they can get close to the source and guarantee optimum fume capture.

To increase filter lifetime and save energy, most Zero-Smog® Systems are fitted with an automatic speed control (dependent on the number of workplaces connected). Effective pre-filters, integrated into the units, save the main filter and can be exchanged very simply.



## Zero-Smog® System



Weller® Zero-Smog® Systems offer two solutions for fume extraction:

#### **Tip Extraction**





#### **Tip Extraction**

Weller® FE (Fume Extraction) soldering irons have a smoke tube integrated into the handle. When soldering the tube is positioned directly above the joint and collects any fumes produced. Fume extraction attachments can be retro fitted to non fume extraction Weller® soldering irons.

- Less investment per work place
- Collect pollution direct at source
- Up to 20 collection points with one system (200 m apart)
- Ergonomic friendly with easy access to work piece
- No noise
- Minimal air movement

#### **Volume Extraction**



#### **Volume Extraction**

More suitable for applications involving, for example, solder baths, hot air soldering, micro solders and gluing work. Weller® offers various mobile systems that purify the air at up to a maximum of 8 workplaces.

- Larger areas can be covered
- Low maintenance
- Mobile
- Quick & easy installation
- Economic for 1 to 8 work places
- Remote control



#### **Filter Technology**


Weller® Zero-Smog® Systems are specifically designed for continuous operation in industrial environments. Care and attention at the design stage plus careful component choice and a high quality manufacturing process have given Weller® extraction systems a world wide reputation for reliability and longevity.


Weller® Zero-Smog® Systems have a **three stage filter system** for removing small particles, fumes and gases that are produced in different working processes:

- The hazardous substances are efficiently captured by the nozzle and are absorbed into the filter.
- Bigger particles get caught in the prefilter and smaller particles get caught in the HEPA (High Efficiency Particulate Air) filter.
- The Wide Band Gas Filter removes fumes and adhesives.

End product – clean air – is re-circulated into the workplace.

Filter Class	Recommended Application
F 5	for standard applications
F 7	for applications with high flux content
H12 / H13	filter for clean rooms 1000 – 100

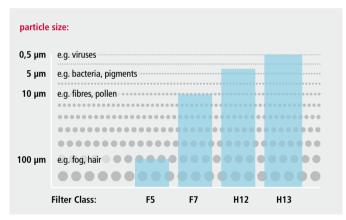


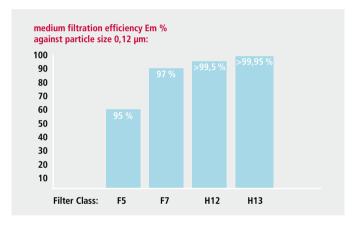

Filter Class F5, F7: Fine dust filter as per EN 779
Filter Class H12/H13: According EN 1822 HEPA (High Efficiency Particulate Air) Filter

#### Filter Process

2.+3.

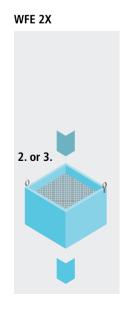

1. 2. or 3.

WFE 20D, WFE 2S, WFE 4S, WFE 8S,

#### 1. Fine dust filter

For standard applications with a small amount of flux and pollution gases with high solid content, Weller® offers filter classes **F5 or F7**.

#### 2. Compact filter consisting of:

#### **HEPA** filter

Filters particles up to 0,3 µm. Weller offers HEPA (High Efficiency Particulate Air) filters of class **H12** and **H13**, medium filtration efficiency 99,5 % / 99,95 %.

#### Wide band gas filter

For cleaning narmful fumes and vapours. The Weller wide band gas filter consists of 50 % active carbon and 50 % Puratex. Harmful gases with a high molecular weight are cleaned by the active carbon. Puratex is suitable for absorbing gases of lower molecular weight. Because of its composition, Puratex is able to convert a large number of chemical pollutants by means of molecular modification into non-polluting gases.

#### 3. Gas filter (option)

The gas filter is used for extracting adhesive fumes and solvents. Experience has shown that filtering suspended particles is not so vital in this respect. The gas filter is filled with 50 % active carbon and 50 % Puratex. The HEPA H12 and H13 is omitted.



#### **Volume Extraction**

Volume extraction is the **best choice** where extraction over a wide area is required. It is an **economical** way to eliminate polluted process air as there is no need for fixed installations and maintenance requirements are minimal. Arms and nozzles do not require daily cleaning. Energy costs are saved because the cleaned air is re-circulated back into the work area and does not need to be heated or cooled like external air.

Weller® has a broad range of filter units for volume extraction applications. Speed control allows optimal air flow regulation for each working place independent of the connected workplaces. Units can be remotely controlled via a remote control system (available as accessory) or by a PC (RS232) connection.





#### **Volume Extraction Units**



■ WFE 8S

up to 8 workplaces, small solder ovens, selective and reflow soldering equipment, integrated pre-filter





■ WFE 4S

up to 8 workplaces



WFE 2S

up to 4 workplaces



■ WFE 2X

up to 2 workplaces



■ WFE 2ES / WFE 2CS

up to 2 workplaces

#### Characteristics

- For applications where extraction over a wide working area is required.
- Mobile units suitable for stand alone and central applications.
- All units equipped with maintenance free brushless turbine.
- Connectable to external air outlet.
- Low vacuum up to 2.800 Pa and high volume for efficient volume extraction.
- Maximum bridging distance 30 m (WFE 4S using Weller® pipe system 75) equally distributed to all connected exhausts.
- Cost saving through automatic air flow control which provides each workplace with intelligent air flow regulation regardless of the connected workplaces.
- Filter condition monitoring on the unit or by remote control (accessory).
- Wide range of extraction arms and nozzles available to achieve optimal work place configuration.

#### **Areas of application**

- Hot air soldering
- Soldering machines, robots, solder baths
- Laser processing
- Adhesive fumes
- Clean room applications (on request)
- Microscope workplaces
- Other fume emitting processes

#### WFE 8S

Powerful fume extraction unit with large integrated pre-filter







8 workplaces, small and

selective equipment

615 m<sup>3</sup>/h

medium sized reflow, wafer,

< 55 db (A) at 1 m distance

The fume extraction unit WFE 8S can be connected to up to 8 extraction arms. This makes the unit suitable to use as a small central system in applications such as soldering, adhesives, clean-room work and laser work. It is also capable for connection to small, selective reflow and soldering ovens. The large integrated pre-filter makes the WFE 8S very suitable for lead-free soldering as it is able to catch a large quantity of particles. The WFE 8S is a mobile system that is simple to install – it does not require any permanent installation.

Its high quality components keep service needs to a minimum. The combination of low running costs and a flexible system independent of fixed installations produces a unit with a very low cost of ownership. WFE 8S can be connected so that it exhausts air. This is an advantage in applications where re-circulation is not allowed. To further increase the filter lifetime and save energy, the WFE 8S has an automatic airflow control - depending on the number of connected workplaces.

#### Scope of supply WFE 8S

- WFE 8S Fume extraction unit 230/120 V / 50/60 Hz with build-in pre-filter
- Compact filter Consists of: HEPA filter H13, wide band gas filter (50 % active carbon, 50 % Puratex)


Order No. 230V	005 36 586 99
Order No. 120V	WFE8S

#### **Attributes**

 Mobile fume extraction unit purifies air up to 8 workplaces

THE REAL PROPERTY OF THE PARTY OF THE PARTY

- Large built-in pre-filter
- The adjustable pressure control guarantees the optimal air flow regulation for each working place - independent of the connected workplaces
- Electronic filter control and easy filter exchange
- 4 wheels to allow easy movement of the unit
- Remote control with alarm function
- Noise damped metal housing
- Quick and simple installation

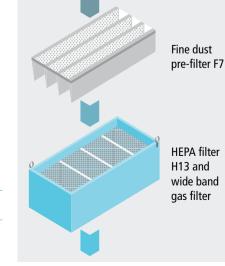

Sound level

Maximum capacity

Maximum extraction rate







#### Attributes

- Mobile fume extraction unit purifies air up to 8 workplaces
- The adjustable pressure control guarantees optimal air flow regulation for each working place independent of the connected workplaces
- Electronic filter control and easy filter exchange
- 4 wheels to allow easy movement of the unit
- Remote control with alarm function
- Noise damped metal housing
- Quick and simple installation





ESD safe

low

Pre-filter to extend capacity of WFE 2S, WFE 4S, WFE 2X



The pre-filter is recommended for use with solder bath, automatic soldering, laser or other major dust emitting applications. It acts as a first stage in the filter process increasing the lifetime of the main filter units. The pre-filter can be fixed directly to the top of the WFE 4S or in conjunction with the WFE 2S and WFE 2X as an external part of the fume extraction system.

#### Scope of supply

- Filter box
- 2 x hose connections 75
   Filters must be ordered separately

Order No.

005 87 358 62

The fume extraction system WFE 4S is userfriendly with quick and simple installation and filter exchange. It has a low noise emission level and is small and convenient to locate within the work area.

The high quality components used in the WFE 4S result in low servicing requirements and long system life. To increase filter lifetime and save on energy, the WFE 4S is fitted with an automatic airflow speed control - depending on the number of connected workplaces. To extend the capacity an external pre-filter can be fixed directly to the WFE 4S.

The powerful maintenance free variable speed turbine is electronically controlled and has a maximum capacity of 615 m<sup>3</sup>/h. It has 3 operating modes:

- Standard speed control selected by the user irrespective of the load on the system.
- Speed limiting control the pump speed is automatically varied to match the load on the system.
- Economy control the rate of fume absorption is maintained at a constant value. The operating hours and the filter condition are recorded for maintenance purposes.

# Fine dust pre-filter F7 HEPA filter H13 and wide band gas filter

#### Maximum capacity 8 workplaces Maximum extraction rate 615 m3/h Sound level 51 db (A) at 1 m distance Standard connection pipe system 75 230/120 V / 50/60 Hz Operating voltage 450 VA Power input Maximum vacuum 2.800 Pa 450 x 450 x 650 mm Dimensions (L x W x H) 17.7 x 17.7 x 25.6 in Weight 21 kg / 46.3 lb

#### Scope of supply

- WFE 4S Fume extraction unit 230/120 V / 50/60 Hz
- Compact filter

Consists of: HEPA filter H13, wide band gas filter (50 % active carbon, 50 % Puratex)

Fine dust pre-filter F7

Order No. 230V	005 36 256 99
Order No. 120V	WFE4S

#### Option: WFE 4S with gas filter

- Compact filter for adhesive fumes, consists of: Wide band qas filter (50 % active carbon, 50 % Puratex)
- Fine dust filter F7

Order No. 230V	005 36 496 99
Order No. 120V	WFE4S

#### WFE 2X

Mobile fume extraction unit purifies air up to two workplaces



#### **Attributes**

 Mobile fume extraction unit purifies air at up to 2 workplaces

A STATE OF THE PARTY OF THE PAR

- Electronic filter control and easy filter exchange
- Wireless remote control with alarm function
- Extra noise damped metal housing
- Quick and simple installation
- Trolley available as accessory
- Minimized foot print
- Switching power supply fits for all global voltages
- Optimized lifetime filter






The WFE 2X is a fume extraction unit and is suitable for applications with a high demand for gas and particle filtration, e.g. soldering, adhesives, clean room work and laser.

It can be placed on a trolley and be moved easily between different work places. Variable speed and the alarm function for filter exchange can be set via the remote control. For applications which produce a large quantity of particles, e.g. lead-free soldering, an external pre-filter can be fitted to increase the lifetime of the main filter. To make cleaning easier, the WFE 2X can be suspended under the work table with special fittings. An RS 232 interface makes it possible to integrate the software with other process equipment.

Technical Data	
Maximum capacity	2 work places
Maximum extraction rate	140 m³/h
Sound level	< 52 db (A) at 1 m distance
Operating voltage	100 – 240 V / 50/60 Hz
Power input	100 W
Maximum vacuum	2.300 Pa
Dimensions (L x W x H)	210 x 460 x 660 mm
	8.3 x 18.1 x 26 in
Weight	15 kg / 33 lb

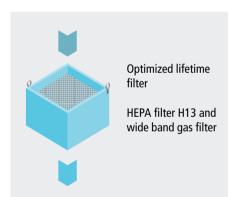

#### Scope of supply

- WFE 2X Fume extraction unit 100-240 V / 50/60 Hz
- Compact filter
  Consists of: HEPA filter H13

Consists of: HEPA filter H13, wide band gas filter (50 % active carbon / 50 % Puratex)

Accessories for WFE 2X see on page 16.

Order No. 230V plug	005 36 588 99
Order No. 120V plug	WFE2X

#### WFE 2X Kit



Mobile fume extraction kit

#### Scope of supply

- 005 36 588 99 WFE 2X Fume extraction unit 100-240 V / 50/60 Hz
- 005 36 579 99 KIT 1 WF 60 Sloped stativ extraction arm for volume extraction consists of:

005 36 598 99 Stativ extraction arm 005 36 573 99 Funnel nozzle 005 36 574 99 Stop valve 005 365 75 99 Bench mounting bracke

005 365 75 99 Bench mounting bracket 005 36 576 99 Extraction hose

Order No. 230V 005 36 589 99






WFE 2S
Mobile fume extraction unit
available in two kits



#### **Attributes**

- Two kits available
- Mobile fume extraction unit purifies air at up to 4 workplaces
- Electronic filter control and easy filter exchange
- 4 wheels to allow easy movement of the unit
- Remote control with alarm function
- Noise damped metal housing
- Quick and simple installation

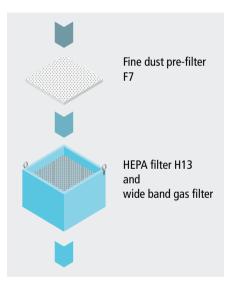



ESD safe

low sound le

The fume extraction unit WFE 2S is easy to install and operate. It is designed as a smaller, central system and is supplied complete with flexible hose, arm and bracket, ready for installation at the workplace. A powerful, maintenance-free pump provides continuous fume extraction at a maximum air extraction rate of 230 m³/h. A built-in microprocessor controls the adjustable pump speed avoiding unnecessary waste of suction power and saving energy. To optimize the degree of pollutant separation, the WFE 2S can be modified with filters for different applications.

#### 2 work places Maximum capacity Maximum extraction rate 230 m<sup>3</sup>/h Sound level 48 db (A) in 1 m distance pipe system 50 Standard connection Operating voltage 120/230 V / 50/60 Hz Power input 275 VA Maximum vacuum 2 700 Pa Dimensions (L x W x H) 320 x 320 x 395 mm 12.6 x 12.6 x 15.5 in Weight 19 kg / 41.8 lb

#### Scope of supply WFE 2S

- WFE 2S Fume extraction unit 120/230 V / 50/60 Hz
- Compact filter
   Consists of: HEPA filter H13, wide band gas filter
   (50 % active carbon / 50 % Puratex)
- Fine dust pre-filter F7

Order No. 230V	005 36 266 99
Order No. 120V	WFE2S

#### Option: WFE 2S with gas filter

■ Compact filter for adhesive fumes. Consists of: wide band gas filter (50 % active carbon / 50 % Puratex)

Order No. 230V	005 36 466 99
Order No. 120V	WFE2SG

#### WFE 2 Kit 1



Portable fume extraction kit for one work station

#### Scope of supply

- 005 36 266 99 WFE 2S Fume extraction unit 120/230 V / 50/60 Hz
- 005 36 572 99 KIT 1 WF Sloped 60 for volume extraction consists of:

005 36 578 99 Extraction arm

005 36 577 99 Slopped nozzle

005 36 574 99 Stop valve

005 365 75 99 Bench mounting bracket

005 36 576 99 Extraction hose

Order No. 230V 005 36 572 99
Order No. 120V WFE2Kit1

#### WFE 2 Kit 2



Portable fume extraction kit for two work stations

#### Scope of supply

- 005 36 266 99 WFE 2S Fume extraction unit 120/230 V / 50/60 Hz
- 2 x 005 36 572 99 KIT 1 WF Sloped 60 for volume extraction consists of:

2 x 005 36 578 99 Extraction arm

2 x 005 36 577 99 Slopped nozzle

2 x 005 36 574 99 Stop valve

2 x 005 365 75 99 Bench mounting bracket

2 x 005 36 576 99 Extraction hose

Order No. 230V 005 36 456 99
Order No. 120V WFE2Kit2

#### WFE 2ES / WFE 2CS

Fume extraction unit as economical solution



Portable fume extraction kit for one work station

The fume extraction unit WFE 2ES is easy to install and operate. It is designed as a smaller central system and is supplied complete with flexible hose, arm and bracket, ready for installation at the workplace.



Technical Data	
Maximum capacity	2 work places
Maximum extraction rate	220 m³/h
Sound level	55 db (A) at 1 m distance
Operating voltage	230V / 50Hz (115V / 60Hz)
Power input	115 VA
Maximum vacuum	1.800 Pa
Dimensions (L x W x H)	320 x 320 x 395 mm
	12.6 x 12.6 x 15.5 in
Weight	9 kg / 19.8 lb

#### Scope of supply

- 005 36 506 99 WFE 2ES Fume extraction unit
- Compact filter

Consists of: HEPA filter H12, active carbonate foam

- Fine dust pre-filter F 5
- 005 36 571 99 KIT 1 WF Funnel 60 for volume extraction consists of:

005 36 578 99 Extraction arm 005 36 573 99 Funnel nozzle

005 36 574 99 Stop valve

005 365 75 99 Bench mounting bracket

005 36 576 99 Extraction hose

 Order No. 230V
 005 36 516 99

 Order No. 120V
 WFE2ES KIT1

#### Option: Arm with slopped nozzle

 005 36 572 99 KIT 1 WF Sloped 60 for volume extraction consists of

005 36 578 99 Extraction arm 005 36 577 99 Slopped nozzle

005 36 574 99 Stop valve

005 365 75 99 Bench mounting bracket

005 36 576 99 Extraction hose

#### Option: WFE 2CS with speed control

	•
Order No. 230V	005 36 526 99
Order No. 120V	WFE2CS

#### **Attributes**


 Mobile fume extraction unit purifies air up to 2 workplaces

- Easy filter exchange
- Quick and simple installation
- Optional: Speed control (WFE 2CS)





SD safe low

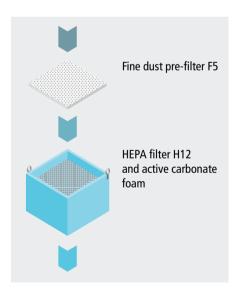






#### **Installation Options**

Installation option for a central system Kit1 WF Sloped 60 005 36 572 99 Kit1 WF Funnel 60 005 36 571 99 with WFE 2S rubber hose 005 87 627 52 connecting piec 005 87 627 51 O-ring 005 87 627 53 Total pipe length 15 m (590.55 in) rubber hose 005 87 627 52 connecting piec 005 87 627 51 O-ring 005 87 627 53 000 0 extraction arm 60 005 36 578 99 WF nozzle funnel 005 36 573 99 rubber hose 005 87 627 52 connecting piece 005 87 627 51 O-ring 005 87 627 53 3 m 005 36 576 99 damper WFV 60 005 36 574 99 rubber hose 005 87 627 52 connecting piece 005 87 627 51 O-ring 005 87 627 53 RS 232 cable (2 m) 005 31 191 99 Ö000 remote control 005 87 359 09

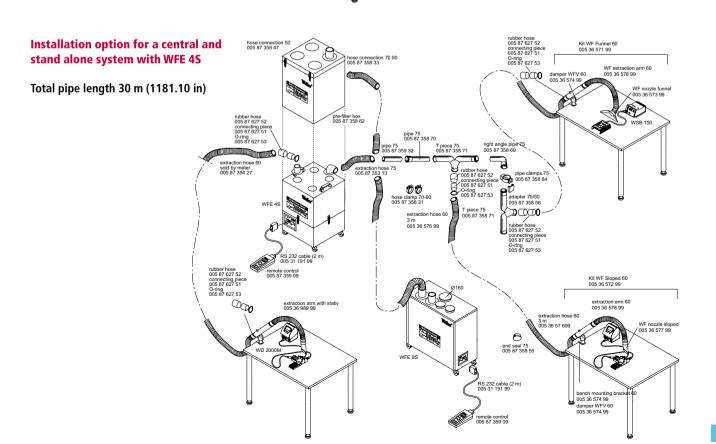

#### **Accessories**

When soldering, gluing or working with solvents it is important to place the nozzle as close to the source as possible to prevent harmful particles and gases being spread into work area.

The Weller® 60 mm (2.36 in) flexible extraction arms allow the quiet and efficient capture of polluted air. The arms and nozzles are simple to install due to the click-on funnels and can easily be fixed into the required position.

AND THE PROPERTY OF THE PARTY OF



Order No.	Description
005 87 358 47	<b>Hose connection 50</b> for WFE 2S and WFE 4S, e.g. for the direct connection of accessories by means of 50 mm (1.96 in) extraction hose. Plastic, black.
005 87 358 32	<b>Hose connection 75</b> for WFE 2S and WFE 4S, e.g. for connection to a stand alone system by means 75 mm (2.95 in) pipe or 75 mm (2.95 in) extraction hose. Plastic, black.
005 87 358 48	<b>Hose connection 50, 90°</b> for WFE 2S and WFE 4S, e.g. for the direct connection of accessories by means of 50 mm (1.96 in) extraction hose. Plastic, black.
005 87 358 33	<b>Hose connection 75, 90°</b> for WFE 2S and WFE 4S, e.g. for connection to a stand alone system by means of 75 mm (2.95 in) pipe or 75 mm (2.95 in) extraction hose. Plastic, black.
005 87 353 13	<b>Extraction hose 75,</b> ø 75 mm (2.95 in), for connection to pipe system 75. Sold by metre. Plastic, grey/black, flexible.
005 36 576 99	<b>Extraction hose 60,</b> ø 60 mm (2.36 in), for connection to pipe system 50. 3 m (118.11 in). Plastic, grey/black, flexible.
005 87 354 27	<b>Extraction hose 60,</b> ø 60 mm (2.36 in), for connection to pipe system 50. Sold by metre. Plastic, grey/black, flexible.
005 87 358 79	<b>Hose clamp 50 – 70 mm,</b> (1.96 - 2.75 in), 2 units, for securing extraction hose 50.
005 87 358 31	Hose clamp 70 – 90 mm, (2.75 - 3.54 in), 2 units, for securing extraction hose 75.







#### Accessories





Order No.	Description
005 36 574 99	<b>WFV 60 Stop valve.</b> Table connector for 60 mm (2.36 in) flex arm and extraction tube including air flow valve.
005 36 575 99	<b>Bench mounting bracket.</b> Maximum width of clamp 100 mm (3.93 in). 100 mm (3.93 in) diameter. Metal, black.
005 36 348 99	<b>Extraction arm,</b> can be mounted directly to work bench, ESD safe.
005 87 627 53	<b>Silicone O-ring,</b> 50 mm (1.96 in) diameter. Seal for 60 mm (2.36 in) flex arm directly on WFE 2S and WFE 2ES.
005 87 358 53	Extraction arm, flexible, ESD safe, metal black.
005 36 349 99	<b>Extraction hood</b> PE transparent, 296 x 248 mm (11.65 x 9.76 in).
005 87 627 50	<b>60/50 Adapter</b> for applications using the 60 mm (2.36 in) extraction system connected to the <b>former</b> 50WFTB and WFFMP50.



#### **Accessories for WFE 2X**

Order No.	Description
005 36 591 99	<b>Hanging device</b> for table mounting for fume extraction unit WFE 2X.
005 36 592 99	<b>Trolley</b> for fume extraction unit WFE 2X.





## Exhaust accessories to blow waste air out of a building

Order No.	Description
005 87 359 20	<b>Exhaust adapter</b> of pipe 100 to fume extraction unit WFE 20D.
005 87 358 40	<b>Exhaust adapter</b> of pipe 100 to fume extraction unit WFE 4S.
005 87 359 15	<b>Exhaust adapter</b> of pipe 75 for fume extraction unit WFE 2S.

Remote control for tip and volume extraction units





Order No.	Description
005 87 359 09	<b>Remote control</b> for fume extraction units WFE 20D, WFE 2S, WFE 4S and WFE 8S. Switching unit on/off, speed setting (only WFE 2S / WFE 4S), filter status display.
005 36 593 99	<b>Remote control</b> for fume extraction unit WFE 2X with 2 m (78.74 in) cable.
005 31 191 99	Interface cable RS 232, 2 m (78.74 in) for remote monitoring by PC (type 1:1).

## **Spare Part Filters**

Order No.	Spare filter WFE 8S:
005 36 594 99	Replacement pre-filter
005 36 595 99	Replacement compact filter
	(4 pieces in one pack)
	Consists of: HEPA filter H13,
	wide band gas filter (50 %
	active carbon, 50 % Puratex)

Order No.	Spare filter for WFE 2X:	
005 36 590 99	Replacement compact filter Consists of: HEPA filter H13,	(
	wide band gas filter (50 % active carbon, 50 % Puratex)	(

Order No.	Spare filter for WFE 4S:	
005 87 358 37	Fine dust filter F5 (10 pieces)	
005 87 358 36	Fine dust filter F7 (10 pieces)	
005 87 358 38	Compact filter	
	Consists of: HEPA filter H13,	
	wide band gas filter (50 %	
	active carbon, 50 % Puratex)	
005 87 358 35	Option: Adhesive fume filter	
	(50 % active carbon, 50 %	
	Puratex)	

Order No.	Spare filter for WFE 2S:
005 87 358 84	Fine dust filter F5 (10 pieces)
005 87 358 85	Fine dust filter F7 (10 pieces)
005 87 358 83	Compact filter
005 87 358 95	Consists of: HEPA filter H13, wide band gas filter (50 % active carbon, 50 % Puratex) Option: Adhesive fume filter (50 % active carbon, 50 % Puratex)

Order No.	Spare filter for WFE 2ES:
05 87 627 01	Fine dust filter F5 (10 pieces)
	Compact filter
	Consists of: HEPA filter H12,
	wide band gas filter
	(10 % active carbonate foam

Order No.	Spare filter WFE 2S/WFE 4S:
005 87 358 60	Filtering ash F7 for large
	quantities of dust
005 87 359 24	Filtering fine dust for sticky of
	arrears (e.g. large quantities of
	liquid flux)


## **Tip Extraction**



#### **Tip Extraction**

Weller® FE (Fume Extraction) soldering irons have a smoke tube adapted to the handle. When soldering the tube is positioned directly above the joint and collects any fumes produced. Fume extraction irons can be connected to the Weller® Zero-Smog® Systems WFE, WFE P (both bench mounted units driving up to 2 irons) or WFE 20D — a mobile unit driving up to 40 irons.

A safety rest with Stop + Go function switches the extraction system on when the FE soldering iron is removed from the safety rest and off after a short delay when the iron is replaced (WFE & WFE P only). Fume extraction attachments can be retro-fitted to non fume extraction Weller® soldering irons.

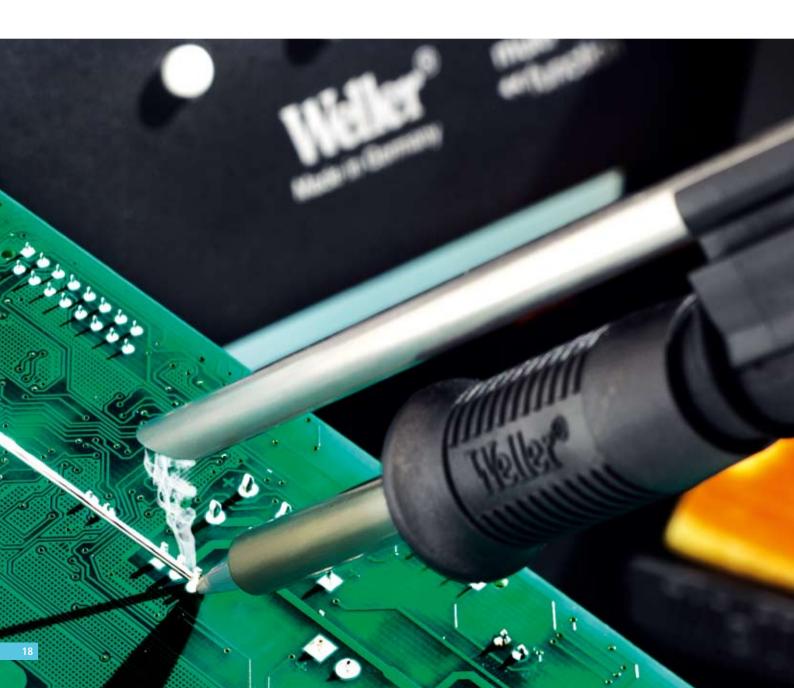



#### **Tip Extraction Units**





■ WFE 20D

up to 20 workplaces



■ WFE P

up to 2 workplaces



WFE

up to 2 workplaces

#### **Characteristics**

- FE (Fume Extraction) soldering irons extract fumes directly at the soldering tip.
- Less airflow and high vacuum, up to 12.000 Pa for efficient fume extraction.
- Maximum bridging distance 200 m (7874 in), WFE 20D requires Weller® pipe system 50.
- Filter condition warning LED on the unit or remote control via RS 232 and PC (WFE 20D).
- Variable electronically controlled pump speed, adjustable at the unit or by remote control via RS 232 and PC (WFE 20D).

#### **Areas of application**

- Hand soldering
- Small solder baths

## **Tip Extraction**



#### WFE

Small, portable, compressed air driven fume extraction unit



**Technical Data** 

Sound level

Height Diameter

Weight

Maximum capacity

Maximum vacuum

Operating pressure

Air consumption



2 FE soldering irons

20.000 Pa

3,5 - 6 bar

200 mm (7.8 in)

140 mm (5.5 in)

2,7 kg / 5.9 lb

30 l/min

< 39 db (A) at 1 m distance



fe low sound

The fume extraction unit WFE requires clean and oil-free compressed air. The vacuum is generated by a maintenance-free compressed air converter. The contaminated air is purified by a pre-filter and main filter system. A compressed air cleaning filter removes additional odours caused by the compressed air. This highly efficient filter system makes the WFE a genuine air recovery system. The filter-lift system allows fast and convenient filter cartridge replacement. The FE (Fume Extraction) soldering irons are connected directly to the unit — additional leads are not required.


#### Scope of supply

- WFE Fume extraction unit
- Compressed air cleaning filter
- Compact filter
   Consists of: HEPA filter H13, wide band gas filter
   (50 % active carbon, 50 % Puratex)
- Fine dust filter F7

Order No. 230V	005 36 402 99
Order No. 120V	WFE

#### **Attributes**

- Up to 2 FE soldering irons can be connected
- Maintenance-free compressed air converter
- Portable unit for stand alone applications

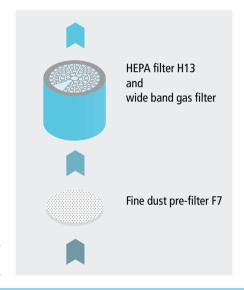

## WFE P Small, portable, electrically driven fume extraction unit



**Technical Data** 



**%**⟨**⟨⟨⟨** 

low sound

The Weller® WFE P is a line voltage fume extraction unit designed to run with one or two FE (Fume Extraction) soldering irons. The WFE P has an electric, long-life, soundproofed vacuum pump to produce the required vacuum — it does not need a compressed air supply. The vacuum pump has two power settings which can be selected by means of rocker switches depending on the number of FE soldering irons connected to the unit. This saves energy. The motor is maintenance-free and has a thermal over load to protect the unit. The filter lift system allows fast and convenient main filter replacement. FE soldering irons are connected directly to unit — additional leads are not required.


#### Scope of supply

- WFE P Fume extraction unit
- Compact filter
   Consists of: HEPA filter H13, wide band gas filter
   (50 % active carbon. 50 % Puratex)
- Fine dust filter F7

Order No. 230V	005 36 386 99
Order No. 120V	WFE2P

#### Attributes

- Up to 2 FE soldering irons can be connected
- Electric vacuum pump to produce the required vacuum
- 2 power stages for higher extraction performance with 2 FE soldering irons
- Portable unit for stand alone applications

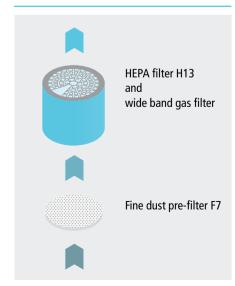

#### Maximum capacity 2 FE soldering irons Sound level < 45 db (A) at 1 m distance Operating voltage 230 V / 50 Hz Power input 70 W Maximum vacuum 30.000 Pa Height 295 mm (11.6 in) Diameter 140 mm (5.5 in) 4 kg / 8.8 lb Weight



#### **WFE 20D**

Mobile, powerful, electronically driven fume extraction unit







Up to 5 Weller® FE (Fume Extraction) soldering irons can be connected directly to the fume extraction unit WFE 20D. Using the Pipe System 50 (available as accessory) up to 40 FE soldering irons can be supported by the unit. The powerful maintenance-free turbine generates a vacuum of 12.000 Pa and is electronically

controlled. Operating hours and filter contamination level are also recorded electronically. The filter system achieves a filtration rate of 99,95 % as per EN 1822 with a particle size of 0,12  $\mu$ m.

#### Characteristics

- Two operating modes:
   Mode 0: Vacuum regulated to 12.000 Pa
   Mode 1: Extraction performance can
   be set between 20 % 100 % with the control buttons.
- Electronic filter check (LED) through differential pressure measurement.
   If the specified degree of contamination is exceeded, the unit switches off.
- Electronic filter operation status display.
   For better management of filter change intervals the filter operating hours can be pre-specified. The need for filter change is indicated in good time allowing adequate time for filter procurement and replacement. Interface RS 232 for remote monitoring or remote control.
- Remote control available as accessory.

#### **Attributes**


- Up to 40 FE soldering irons can be connected
- Electric driven, maintenance free turbine produces the required vacuum
- 4 wheels to allow easy movement of the unit
- Mobile unit for central and stand alone applications
- Central installation for pipe systems up to 200 m (7874 in)

40 FE soldering irons
< 51 db (A) at 1 m distance
230 V / 50 Hz 120 V / 60 Hz
630 VA
12.000 Pa
100 m³/h
450 x 450 x 695 mm
17.7 x 17.7 x 27.3 in
45 kg / 99 lb

#### Scope of supply

- WFE 20D Fume extraction unit
- Compact filter
   Consists of: HEPA filter H13, wide band gas filter
   (50 % active carbon, 50 % Puratex)
- Fine dust filter F5

Order No. 230V	005 36 476 99
Order No. 120V	WFE20D

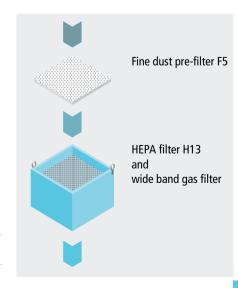

## **Tip Extraction**



#### **FE (Fume Extraction) Soldering Irons**



The smoke absorption tube is integrated into the handle. It can be placed over the joint when soldering but can be retracted when access to the joint is a problem and can also be removed for cleaning. The irons are temperature controlled, ergonomic and allow precise handling. These electronically controlled irons

can be driven from any Weller® power unit compatible with the rating of the iron or any Weller® rework station. The range of iron power ratings and the extensive range of solder tips mean that there is an iron to suit all applications. The FE soldering irons are supplied with a burn proof hose 5 mm (0.19 in) diameter, 2,5 m (98.42 in) long.



ESD safe



Order No.	Description
005 33 150 99	<b>FE 50</b> Soldering iron set 50 W / 24 V, with safety rest KH 20*. Not available in US.
005 32 152 99	<b>FE 50M</b> Soldering iron set 50 W / 24 V, Magnastat controlled with safety rest KH 20*. Not available in US.
005 33 151 99	<b>FE 75</b> Soldering iron set 80 W / 24 V with safety rest KH 20*. For use with LT tips.
005 26 162 99	<b>FE 80</b> Soldering iron 80 W / 24 V with safety rest KH 20*. Not available in US.

<sup>\*</sup> Cleaning brush for FE tubes and fume extraction funnels are included in the scope of supply of the soldering irons for use with KH 20 and KH 23 safety rests.

#### **FE Attachments**





A range of FE attachments are available to fit standard Weller® soldering and desoldering irons to convert them to fume extraction versions. The attachments are supplied with all necessary fittings and hoses. The performance of the retro-fitted tools is not affected.

For Weller® soldering irons WP 120, WP 80, WSP 80, WMP, MLR 21 or soldering irons with handle diameter 10-13 mm (0.39-0.51 in). Clip will be fixed with an silicone O-ring to the soldering iron.

Order No.	Description
005 29 186 99	FE Attachment with tube, ø 6 mm (0.23 in) for WP 120, WSP 80, WP 80, MLR 21,
	MLR 80, WMP.
005 29 185 99	FE Attachment with tube, ø 4,5 mm (0.17 in) for WP 120, WMRP and WSP 80,
	WP 80, MLR 21, MLR 80, WMP for fine soldering applications.
005 87 448 75	FE Spare Clip-Set for FE attachment, tube ø 4,5 mm (0.17 in).
005 87 448 76	FE Spare Clip-Set for FE attachment, tube ø 6,0 mm (0.23 in).
005 15 156 99	WDH 50 safety rest for soldering iron with FE attachment.
005 25 125 99	FE Attachment for LR 21, LR 82, TCPS, W 61, W 101, WSP 150 with safety rest AK 1.
005 28 126 99	FE Attachment for WSF 80D5/8.
005 13 125 99	FE Attachment for DS 22, DS 80 and DSX 80 desoldering iron.



#### **Accessories for FE Irons**



Order No.	Description
005 36 352 99	<b>Locking clip.</b> The locking clip is used to disconnect FE (Fume Extraction) soldering irons that are not required so that there is no unnecessary loss of extraction power. The clip can be operated quickly and easily.
005 25 410 00	<b>Extraction hose (spare part)</b> Heat-resistant silicone hose, $\emptyset$ 5 mm (0.19 in), for all FE (Fume Extraction) soldering irons (sold by metre).



Order No.	Description
	Cord support. The cord support keeps the soldering iron cord out of the direct working area. This allows easier handling of the soldering iron.
005 15 065 99	Cord support for safety rest AK 20.
005 15 066 99	Cord support for safety rest KH 20/23.

# Safety Rests for FE Soldering Irons









Order No.	Description
005 15 030 99	<b>AK 20</b> Safety rest for FE 50, FE 50M, FE 75, FE 80; for LR 21, LR 82 and TCP with attachment.
005 15 020 99	KH 20 Safety rest for FE 50, FE 50M, FE 75, FE 80.
005 15 023 99	KH 23 Safety rest for FE 25.
005 15 140 99	WPH 80 Safety rest for WSP 80FE; for MLR 21 with FE attachment.

## **Tip Extraction**



# Safety Rests with Stop + Go Function for FE soldering irons together with fume extraction units WFE and WFE P

The Weller® Stop + Go safety rests are recommended accessories for FE soldering irons using the WFE or WFE P extraction units. A fibre optic sensor switches the extraction unit on when the FE soldering iron is removed from the

safety rest and off when the FE soldering iron is replaced in the safety rest. After a short delay to gather the fumes from any solder on the tip, it switches the unit off. This saves the soldering tip and reduces the running costs.

in.

Order No.	Description
005 15 086 99	<b>KHP</b> Pneumatic basic unit (for WFE), safety rest with Stop + Go function with fibre optic sensor for soldering irons FE 25, FE 50, FE 50M, FE 75 and FE 80.
005 15 076 99	<b>KHE</b> Electric basic unit (for WFE P), safety rest with Stop + Go function with fibre optic sensor for soldering irons FE 25, FE 50, FE 50M, FE 75 and FE 80.
005 15 080 99	<b>KHE/P</b> Second safety rest with fibre optic sensor for extending to 2 workplaces for soldering irons FE 25, FE 50, FE 50M, FE 75 and FE 80.
005 15 084 99	<b>KHP 80</b> Basic unit pneumatic (for WFE) safety rest with Stop + Go function with fibre optic sensor for soldering iron WSP 80FE.
005 15 083 99	<b>KHE 80</b> Basic unit electric (for WFE P) safety rest with Stop + Go function with fibre optic sensor for WSP 80FE.
005 15 141 99	<b>KHE 80/P 80</b> Second safety rest with fibre optic sensor for extending to 2 workplaces for WSP 80 FE.

Not available in US.



## **Accessories** for workbench installations



Order No.	Description
005 36 316 99	<b>Extraction hose 40</b> , 1 m (39.37 in), ø 40 mm (1.5 in). Complete with 2 connecting elements for direct connection of unit (WFE 20D) to pipe system 50. Plastic, grey/black, flexible.
005 36 414 00	<b>Extraction hose 40</b> , ø 40 mm (1.5 in) without connecting elements. Sold by metre. Plastic, grey / black, flexible.
005 36 415 99	<b>Connecting element 40 – 50</b> for connecting extraction hose 40 and pipe system 50. Rubber, black.
005 36 326 99	<b>Extension hose</b> DN 17 (13 x 3 mm), 5 m (198.85 in), ø 17 mm (0.6 in), used where the fume extraction iron is further than 2,5 m (98.42 in) from the pipe system 50. <b>Note:</b> Connection nipple for hose 17 and adapter 17 will be required. Plastic, transparent.
005 87 358 65	<b>Connection nipple</b> for extension hose 17. Amend direction to read direct.
005 87 358 66	Nut G 3/8" for connection nipple.
005 36 343 99	<b>Adapter 17</b> for connection extension hose DN 17 with ø 5 mm (0.19 in) extension hose of FE irons.
005 36 338 99	<b>Connection nipple</b> for 5 mm (0.19 in) diameter extraction hose to connect FE soldering irons directly to pipe system 50. The connection nipple is screwed at any point into the pipe system.
005 87 350 50	Amend cap closure to dust cap.


## **Spare Part Filters**

Order No.	Spare filter for WFE:	Order No.	Spare filter WFE 20D:	Order No.	Spare filter for WFE P:
005 87 357 57 005 36 410 99	Compressed air - cleaning filter Compact filter Consists of: HEPA filter H13, wide band gas filter (50 % active carbon, 50 % Puratex)	005 87 358 37 005 87 358 36 005 87 358 38	Fine dust filter F5 Fine dust filter F7 Compact filter Constists of: HEPA filter H13, wide band gas filter (50 %	005 36 410 99 005 36 407 99	Compact filter Consists of: HEPA filter H13, wide band gas filter (50 % active carbon, 50 % Puratex) Compact filter
005 36 407 99	Compact filter Consists of: HEPA filter H13, wide band gas filter (100 % active carbon)		active carbon, 50 % Puratex)	005 36 421 99	Consists of: HEPA filter H13, wide band gas filter (100 % active carbon) Fine dust filter F7 (3 pieces)
005 36 421 99 005 36 597 99	Fine dust filter F7 (3 pieces) Compact filter with enlarged pre-filter			005 36 597 99	Compact filter with enlarged pre-filter

## **Tip Extraction**



#### **Installation Options**

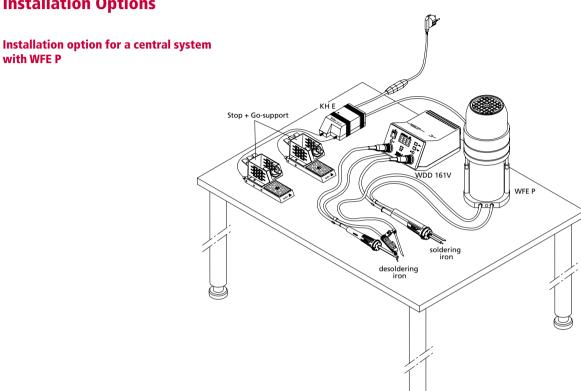

Installation option for a central and stand alone system with WFE 20D

#### stand alone system with pipe system 50 central system right angle pipe 50 pipe 50 005 36 322 99 005 36 323 99 T-piece 50 005 36 344 99 branch 50 005 36 321 99 pipe 50 005 36 323 99 **TO** O pipe clamps 50 005 36 329 99 double socket 50 005 36 319 99 connecting element 40-50 005 36 415 99 pipe 50 005 36 323 99 8 extension hose 17 005 36 326 99 adapter 17 005 36 343 99 WFE 20D RS 232 cable (2 m) 005 31 191 99 remote control 005 87 359 09



#### **Pipe Systems for Tip and Volume Extraction**

#### **Pipe System 50 Tip Extraction**

Tip extraction systems demand a high quality, constant level of vacuum across the installation. To achieve this it is necessary to use a pipe system with a relatively small diameter. The Weller® pipe system 50 allows extraction **installations of up to 200 m (7874 in)** when used with the WFE 20D unit in a stand alone system. The pipe sections are designed to join together and have internal sealing bushes. In a central system, the FE soldering irons are connected directly to the fume extraction units.

#### **Pipe System 75 Volume Extraction**

Volume extraction systems require a large volume of air to be extracted and the level of vacuum is of lesser importance. This means that a relatively large diameter pipe system is required. If the pipe diameter is too small the flow resistance is increased and extraction capacity reduced. The pipe system 75 allows **installations up to 30 m (1191.1 in)** with the WFE 4S used in a stand alone system. The pipe sections are designed to join together and have internal sealing bushes.



Order No.		Description
Pipe System 50	Pipe System 70	
005 36 323 99	005 87 358 70	<b>Pipe</b> , 2 m (78.74 in), with seal at one end. PEHD*, black.
005 36 322 99	005 87 358 69	<b>Right angle pipe,</b> 90°, 0,2 m (7.87 in), with seal at one end. PEHD*, black.
005 36 344 99	005 87 358 71	<b>T-piece,</b> 2 x 90°, 0,5 m (19.68 in), with 3 seals. PEHD*, black.
005 36 321 99		<b>Branch,</b> 2 x 45°, 0,3 m (11.81 in), with 2 seals. PEHD*, black.
005 36 319 99		<b>Double socket.</b> PEHD*, black.
005 36 324 99	005 87 358 55	End seal. Plastic, transparent.
005 36 329 99	005 87 358 64	<b>Pipe clamps</b> for pipes, e.g. for securing to wall. Plastic, grey.
	005 87 358 63	<b>Adapter</b> pipe system 75 to pipe system 50 with seals.
	005 87 358 56	<b>Adapter</b> PEHD* pipe system 75 to pipe system 50, without seals.

<sup>\*</sup>PEHD = Polyethylen High Density

GERMANY

Cooper Tools GmbH

Carl-Benz-Straße 2 74354 Besigheim Tel: (07143) 580-0

Fax: (07143) 580-108

ITALY

Cooper Italia S.r.I.

Viale Europa 80 20090 Cusago (MI) Tel: (02) 9033101 Fax: (02) 90394231

CANADA

Cooper Hand Tools - Canada

164 Innisfil Street Barrie, Ontario Canada L4N 3E7 Tel: (705) 728 5564 Fax: (800) 403 8665 II S A

Cooper Hand Tools World Headquarters

1000 Lufkin Road Apex, NC 27539 USA Tel: (919) 387 0099

Fax: (919) 387 2614

SWITZERLAND

Erem S.A.

Rue de la Roselière 8 1400 Yverdon-les-Bains Tel: (024) 426 12 06

Fax: (024) 425 09 77

CHINA

Cooper Hand Tools

18<sup>th</sup> Floor, Yu An Building 738 Dongfang Road Pudong, Shanghai 200122 China Tel: (21) 5111 8300

Fax: (21) 5111 8446

FRANCE

Cooper Tools S.A.S.

25 Rue Maurice Chevalier BP 46 77832 Ozoir-la-Ferrière Cedex

Tel: (01) 60.18.55.40 Fax: (01) 64.40.33.05

GREAT BRITAIN

**Cooper Tools** 

A Division of Cooper (GB) Ltd. 4<sup>th</sup> Floor Pennine House Washington, Tyne & Wear

NE37 1LY

Tel: (0191) 419 7700 Fax: (0191) 417 9421

ΔΙΙΣΤΒΔΙΙΔ

Cooper Tools Pty. Limited

P.O. Box 366 519 Nurigong Street Albury, N.S.W. 2640

Australia

Tel: (2) 6058-0300 Fax: (2) 6021-7403

www.cooperhandtools.com/europe www.weller.eu

